

Service Bulletin No: 26-001

Ref No: 216

Modification No: EC-16-0365

ATA Chapter: 26

**FIRE PROTECTION - FIRE EXTINGUISHER INSTALLATION  
INSTALLATION OF A REPLACEMENT FIRE EXTINGUISHER P/N 959.08.06.220****1. Planning Information****A. Effectivity**

PC-6 aircraft MSNs 624, 630, 633, 639, 640, 641, 643, 644, 648, 649, 749, 751, 757, 759 and 761.

**B. Concurrent Requirements**

None.

**C. Reason****(1) Problem**

The fire extinguisher P/N 959.08.06.214, installed on the rear of the pilot's seat base, is obsolete.

**(2) Solution**

Install a new fire extinguisher P/N 959.08.06.220.

**D. Description**

This Service Bulletin gives the data and instructions to:

- Remove the existing fire extinguisher and attachment bracket
- Install a new attachment bracket and fire extinguisher

**E. Compliance**

Optional.

**F. Approval**

The technical content of this Service Bulletin is approved under the authority of DOA No. EASA. 21J. 357.

PILATUS advises Operators/Owners to check with their local Airworthiness Authorities for any changes, local regulations or sanctions that may affect the embodiment of this Service Bulletin.

**G. Copyright and Legal Statements**

© Pilatus Aircraft Ltd. This document contains proprietary information that is protected by copyright. All rights are reserved. No part of this document may be copied, reproduced or translated to other languages without the prior written consent of Pilatus Aircraft Ltd.

In connection with the use of this document, Pilatus does not provide any express or implied warranties and expressly disclaims any warranty of merchantability or fitness for a particular purpose. This document contains trade secrets, confidential and/or proprietary information of Pilatus and technical data subject to export control laws and regulations, including the U.S. Export Administration Regulations (EAR). Disclosure or distribution of this document contrary to the EAR, and other laws and regulations, is strictly forbidden. The above restrictions may apply to data on all pages of this document.

**H. Manpower**

	Total
Preparation	0,5
Removal	0,25
Modification	0,25
Installation	0,5
Close up	0,5
<b>TOTAL MAN-HOURS</b>	<b>2,0</b>

**NOTE:** Man-hours figures do not include the time required to cure sealants, paints and adhesives.

**I. Weight and Balance****(1) Weight Change**

- 0,063 kg

**(2) Moment Change**

- 0,191 kgm

**J. Electrical Load Data**

Not Applicable.

**K. Software**

Not changed.

**L. References**

Airworthiness Limitations (AL) Doc. 02334: Appendix E.

**M. Publications Affected**

Illustrated Parts Catalog (IPC): 26-24-00.

**N. Interchangeability of Parts**

Pre and Post-Service Bulletin 26-001 items are not interchangeable.

**2. Material Information****A. Material - Price and Availability**

No modification kit is required for this Service Bulletin.

Operators who require further information and/or Service Bulletin material should contact their Authorized Pilatus Service Center, or: .

PILATUS AIRCRAFT LTD  
CUSTOMER SUPPORT MANAGER  
CH-6371 STANS  
SWITZERLAND

General Aviation:  
Tel: + 41 41 619 3333  
Fax: + 41 41 619 7311  
eMail: SupportPC12@pilatus-aircraft.com